Must read this before installation
Important instructions about your CISS system WF600

1. If your printer is brand new you must first install the original cartridges that came with your printer. The reason for this is because the printer needs to initialize with the original cartridges. CISS cannot initialize a new printer and the printer will show an error-saying cartridge cannot be recognized.

2. After you remove original cartridges you can install CISS.

3. Please don't wait until your original cartridges are empty before installing CISS. In case CISS has a problem you still have your original cartridges to fall back on.

4. After installing CISS if there is something wrong or there is a printer error coming up- Please e-mail Devin at cbiss@superpremiumelectronics.com

5. Make sure to describe your printer error in detail and what you have tried so far to fix it. I will help you fix it or send replacement parts or a replacement unit.

6. Your ciss is equipped with auto reset chips ink levels only reset when ink is down to last 5%-10%. Auto reset chips will not reset if ink is at 80% or 50% and so on. If error has come up on you printer saying cartridges are missing; press the ink button and then remove all the cartridges. Wait 30 seconds and then put the cartridges back into the printer. Make sure to press down firmly to ensure cartridges are in all the way.

Thank you,

Warning!
Please keep ink tanks on the same level as the printer. (on the same desk bottom of printer = bottom of ink tanks)
DO NOT put ink tanks above the printer or on top of the printer.
Air Filters must be installed on to ink reservoirs outside the printer. Do not put air filters inside the printer
Do not mix ink from different manufactures. Mixing ink may cause ink to clog in the ciss or even worse in your printer.

www.SuperPremiumElectronics.com

CIS for Epson Workforce 600

Install Instructions

Thank you for purchasing Continuous Ink Supply System. We appreciate your support and will try our best to make your experience with our products a pleasant one. Printing has been a different experience ever since you installed Continuous Ink Supply system on your own printer. Just imagine being able to print without regard to the ink level in those expensive little cartridges.

Please take your time installing Continuous Ink Supply system. Do not remove your old cartridge until you have the CIS system primed and ready to install (to prevent the drying of heads). In addition, make sure you are getting perfect nozzle checks before installing the ST CIS system. The CIS system won't be able to work properly if the nozzles are previously clogged.

Most people get a perfect nozzle check the first time after installing the Continuous Ink Supply system; others may need to run two or three cleaning cycles or let the printer sit for a while before they get the perfect results.

1. General Guide:
1) Components
2. CIS system 1 set
3. Air filters 4 pcs
4. Refill syringe 1 pc
5 Opening box inspection
6 Check to see if any tubes have been separated from the CISS

2. Printer testing:
1) Check whether the printer is in normal condition, like mechanical status, lubrication status etc.
2) Print testing lines to ensure the printing head is good condition.
3) Print pictures to see whether the printing image is ok.

2) Opening box inspection
A, Check whether all the accessories are ready.
B, Check whether there's leakage of the CISS, whether some tubes have been separated from the CISS

2. Printer testing:
1) Check whether the printer is in normal condition, like mechanical status, lubrication status etc.
2) Print testing lines to ensure the printing head is good condition.
3) Print pictures to see whether the printing image is good.

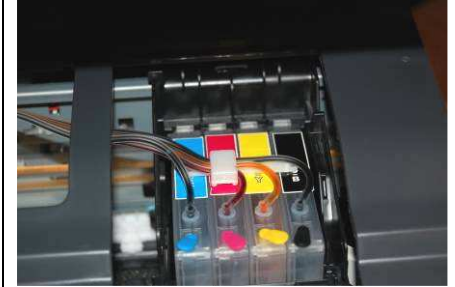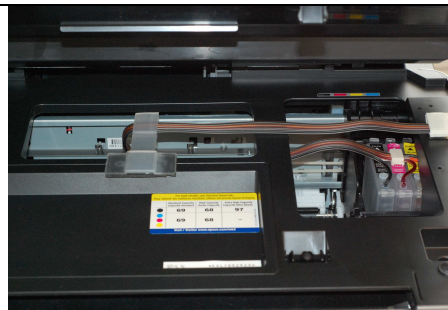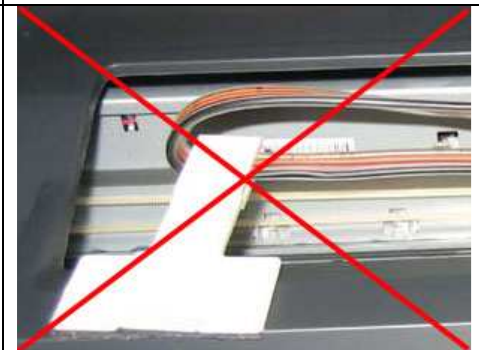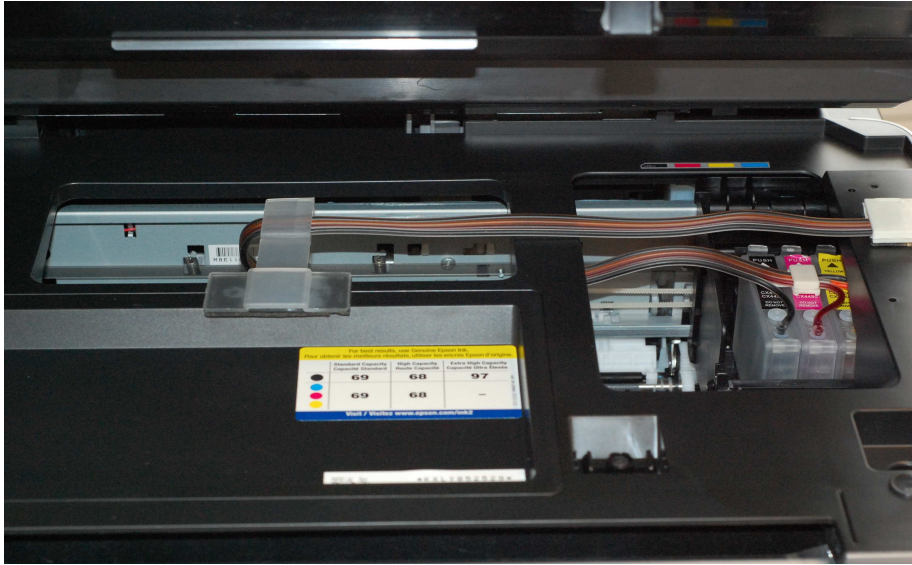|		
Press the button on the printer to change Ink cartridge. Once the print head moves to the cartridge changing position you are ready to install. (If you don't know how to do that please read your printer manual)		Remove Print head cover by inserting flat head screw driver and twisting it to make enough space for the print head cover to come out.
Move Printhead to the left	Place cartridge as shown above then move the printhead back.	Install cartridges. Be sure to press down very firmly to make sure the cartridges are in all the way (you will hear a click).
Install two ink holding clips as shown in the picture (See bigger picture on the last page),	Install ink line as shown in the picture. Notice the ink line is inserted from the top then comes down.	**WRONG – DO NOT install like this.**
Install ink line as shown in the picture.	Pull out the small rubber plug from the air hole as picture shown above. For all 4 colors	Place 4pcs of air filters into air holes, For all 4 colors. With the fat side down

Final Step

Adjust ink hose so that you have just enough of the ink line to move all the way to the left and right. Move the printhead all the way to the right to insure there's enough line (See picture below). However, do not leave any extra slack in the ink line because any extra slack can cause a print head to jam and you will have a problem on your hands. Here I show a large picture of a properly installed CISS.

Make sure your Installation looks exactly the same.

**If printer gives you an error on the screen that cartridges not installed remove cartridges from printhead and reinstall them back that should fix the problem. You may have to remove and reinstall cartridges to reset ink levels.

After Installation print a nozzle check.
If you have broken lines on the nozzle check run a head cleaning. Then let your printer sit 2-3 hours then run another nozzle check. If you still see broken lines then do another head cleaning and let it sit 3-4 hours, then print a nozzle check. Sometimes it takes 3-4 head cleanings. Do not run more than 3 head cleanings in a row. Let your printer sit a while after each head cleaning. Letting the printer sit will help to clear up any printing problems.

Refilling Ciss Instructions

Please refill CISS Ink tanks when the ink is down to ¼ of the ink tank. Do not let ink run out because that would let air into the system and cause printing problems.

To refill the ink simply remove filling rubber plugs on top of the CISS and fill the ink with syringe provided.
Do not fill ink more than 80% of the ink tank. Filling to the top may cause ink to leak.